

# ATX-770R

## START-UP RECOMMENDATIONS

### Filled Polypropylene

#### Barrel Temperatures

| Nozzle          | C4              | C3              | C2              | C1              |
|-----------------|-----------------|-----------------|-----------------|-----------------|
| 420° F / 215° C | 430° F / 220° C | 410° F / 210° C | 390° F / 200° C | 375° F / 190° C |

For harder to fill parts the temperatures may have to be increased. Keep lower temperatures in the rear zones to allow venting through hopper.

#### **Melt Temperature**

Maximum temperature with a hand pyrometer should be 380° F to 440° F (193° C to 227° C).

#### **Mold Temperature**

Typically 80° to 100° F (27° C to 38° C).

#### **Injection Pressure**

The preferred range is 50 to 60% of machine capacity. Pressure should be sufficient to fill the mold without hesitation or flashing.

#### **Holding Pressure**

Setting should be lower than boost pressure with a minimum amount of time to prevent over-packing of the part.

#### **Injection speed**

Slow to medium speed to prevent excessive shear on the material.

#### **Cushion**

Maintain at 10-20mm to provide enough material for consistent parts.

#### **Decompression**

Use only when necessary to prevent nozzle drool.

#### **Screw RPM**

Screw should stop 1 to 2 seconds before mold open. A lower RPM is preferred for mixing and uniform melt temperature.

#### **Drying**

Material should be dried for a minimum of 2 hours and a maximum of 4 hours at 212° F (100° C).

*Disclaimer: The user assumes all risk and liability concerning the use of these recommendations.*

---